## AEROSTAR INTERNATIONAL, INC. SERVICE LETTER 108

NOVEMBER 8, 1994

SUBJECT: DEFLATION PANEL FIT IN AERO 65(S52A) ENVELOPE, DRAWING

NUMBER 52052-09

APPLICABILITY: All S52A envelopes serial numbers S52A-3001 through S52A-3017 with

Parachute or SpringTop deflation panels.

PROBLEM: There have been several situations where the deflation panel in a model

S52A envelope has not been sealing properly.

**DISCUSSION:** Upon further evaluation, it was determined that the overstraps had

shrunk or the length was incorrect. In addition, it was found that the

internal lines also needed to be changed.

PROCEDURE: The overstrap should be increased to 98" inches per Detail ZA (Figure 1)

attached. This should be done per Appendix D, page D-1 of the Aerostar Instructions for Continued Airworthiness. The splice should be completed

near the apex ring on the envelope.

The Parachute top lines should be changed per Detail KE (Figure 2) attached. The centering lines will need to be shortened to  $99" \pm 1/2$ . The confluence lines will need to be lengthened to  $171" \pm 2"$ . It will be necessary to order new confluence lines from the factory. If the customer wishes to change the envelope from a straight pull parachute top to a pulley parachute top, this would be done at their own expense.

The SpringTop paravent lines should measure 99"±1" per Detail VL (Figure 3).

An appropriate logbook entry shall be made following completion of the work by authorized personnel at an approved facility.

If you have any questions contact:

Dee M. Rose Customer Service Manager

AEROSTAR INTERNATIONAL. INC.

P.O. BOX 5057

SIOUX FALLS, SOUTH DAKOTA 57117

PHONE: 605-331-3500 FAX: 605-331-2547



